

# Manhole Inspection Summary

Manhole # S04M\_\_022MH

Printed On: 6/24/2010

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **2) Good**

Record Plat: **04M** Node: **022** Status: **Found**

Insp Date: **3/5/09 11:18 AM**

Incomplete Comments

Crew: **SD RL**  
Inspector: **Chung**  
Firm: **URS**

**Location** Address: **FREDERICK AVE**

Cross Street: **CHEDWORTH LANE**

**Manhole** Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☒ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

**Cover**

Shape: **Circular**

Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment**

☐ Exists

Material:

☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel**

Material: **Brick**

☒ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel**

Material: **Brick**

☒ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench**

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel**

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps**

Count: **5** Missing: **0** ☐ Corroded

**Surcharge**

☒ **Evidence Of Surcharge**

Depth: **4** (ft.) ☐ Active Surcharge Present


Location View



CORBEL OFFSET



Top View

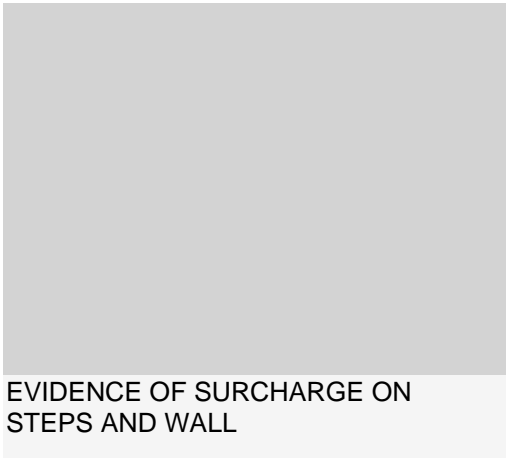

EVIDENCE OF SURCHARGE ON  
STEPS AND WALL

Defect 1



HOLE ON CORBEL OFFSET

Defect 2



HOLE ON CORBEL OFFSET

## Manhole Inspection Summary

Manhole # S04M\_\_022MH

Printed On: 6/24/2010

Page 3 of 4

15 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **15.6** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **14.60** (ft.) Flow Characteristics: **Turbulent**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**


Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **13.60** (ft.) Flow Characteristics: **Fast**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection


Manhole Inspection Summary

Manhole # S04M\_\_022MH

Printed On: 6/24/2010

Page 4 of 4

15 in. Circular Gravity Sewer  
Pipe In @ 7 O'Clock



Pipe Height: **15.6** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **12.30** (ft.) Flow Characteristics: **Fast**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

7 O'Clock Inflow

Drop In @ 7 O'Clock



DROP EXTENSION CLOGGED

Drop: <b>Outside</b>	Rod and Bar
Angled: <b>Yes</b>	Reading: <b>13.20</b> (ft.)
	Inv Depth: <b>14.20</b> (ft.)
Drop Condition: <b>Partly Clogged</b>	

Connects To: **Manhole**  
☐ Possible Illicit Connection